
JERRYGREER'S ENGINEERING© 2020

Wheel Hub - Front Revised: 10-12-2020

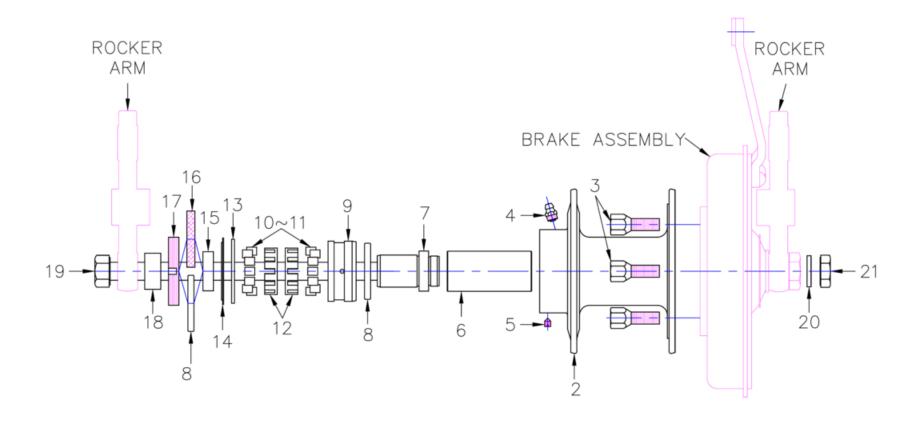

Jerry Greer's Engineering - 1940 Chief - Wheel Hub - Front				
Ref	Part #	Qty	Description	Price
1	JG-3354	1	WHEEL HUB ASSEMBLY, painted black	\$475.00
2	75027	1	WHEEL HUB, includes race and seal installed, painted black	\$325.00
3	37276	6	LUG BOLT, 3/8"-24; Cad Plated	\$8.25
4	416002	1	GREASE FITTING, 5/16"-32 X .25", straight; Cad Plated	\$3.50
5	37277	1	SET SCREW, #10-32 X .261" long, pointed, or use cotter pin 636104	\$4.75
6	40845	1	BEARING SUPPORT SPACER, inner roller bearing race	\$13.00
7	41273	1	BEARING SUPPORT, inner roller bearing	\$42.00
3	37605R	2	NEOPRENE SEAL, hollow axle(improvement)	\$14.00
9	36B317	1	BEARING RACE, outer	\$40.00
10	16A15	24	BEARING ROLLER, .2500" Dia.	\$0.50
11	16A15-T	24	BEARING ROLLER, .2495" Dia. recommended when using ALL NEW PARTS	\$0.50
12	27B181	2	CAGE, 1.450" O.D., Holds 12 rollers	\$45.00
13	37615	1	THRUST WASHER, 1.995" O.D .090" thick, outer roller bearing	\$6.25
14	40843	1	RETAINER, hollow axle seal(Do Not Use with Seal-37605R)	\$5.25
15	41275	1	RETAINER, outer roller bearing thrust washer	\$7.25
16	37605	1	FELT SEAL, 1.750" O.D X .250" thick	\$3.50
17	37388	1	BEARING NUT, 2.117" O.D, RH; Cad Plated	\$25.00
18	40855	1	SPACER, .375" thick, Left front wheel axle, located between rocker arm and wheel hub; Cad Plated	\$8.00
19	41582	1	CENTER AXLE, 9/16"-18 X 8.75" long, recommend replacing hollow axle to insure proper fit; Cad Plated	\$40.00
20	922011	1	WASHER, 9/16" Split Lock; Cad Plated	\$1.50
21	605018	1	NUT, 9/16"-18(Jam)	\$4.00